

## Report 19037.3 8 March 2023



Accredited for compliance with ISO/IEC 17025 – Testing

NATA is a signatory to the ILAC Mutual Recognition Arrangement for the mutual recognition of the equivalence of testing, medical testing, calibration and inspection reports

### OIL-WET INCLINING PLATFORM SLIP RESISTANCE TEST Kodiak Lite

Prepared for:	Australian Select Timbers	
	136 Atlas Boulevard DANDENONG SOUTH VIC 3175	
Specimen Description:	Kodiak Lite, 182x1219 mm.	
No. of Specimens:	3 off	
Surface Structure:	Smooth	
Specimen Preparation:	Washed with water and pH neutral detergent, rinsed then dried.	
Specimen Configuration:	Unfixed	
Test Direction:	Test conducted parallel with embossed finish.	
Joint Type & Width:	N/A	
Air Temperature:	22°C	
Test Standard:	AS 4586:2013 Slip resistance classification of new pedestrian surface materials, Appendix D - Oil Wet Inclining Platform Test	
Test Shoe:	Leipzig V73-SP	
Test Location:	ATTAR 44-48 Rocco Drive, Scoresby, VIC, 3179	
Test Date:	3 March 2023	
Test Personnel:	Dale Siegle and Marcus Braché	

Displacement Space	Not tested	
(rounded to the nearest 0.5cm <sup>3</sup> /dm <sup>2</sup> ):		
Displacement Space Assessment Group	Not tested	
(Appendix E, AS 4586 - 2013):	Not lested	
Corrected mean overall acceptance angle ( $\alpha_{ave}$ )	11°	
(rounded down to the nearest degree):	''	
Classification:	R10	

These results apply only to the specimens tested and it is recommended that before selection of flooring or paving materials the effect of service conditions, including maintenance procedures and wear on their slip resistance be checked.

leep

Dale Siegle Technical Consultant - Compliance Services Approved Signatory

Reviewed By:

Marcus Braché Senior Engineering Technician Approved Signatory

This report may not be reproduced except in its entirety

Page 1 of 3

www.attar.com.au ABN: 14 006 554 785 Engineering Materials Evaluation Pty Ltd t/a ATTAR 44-48 Rocco Drive, Scoresby VIC 3179 Ph: 1300 139 155 E: admin@attar.com.au



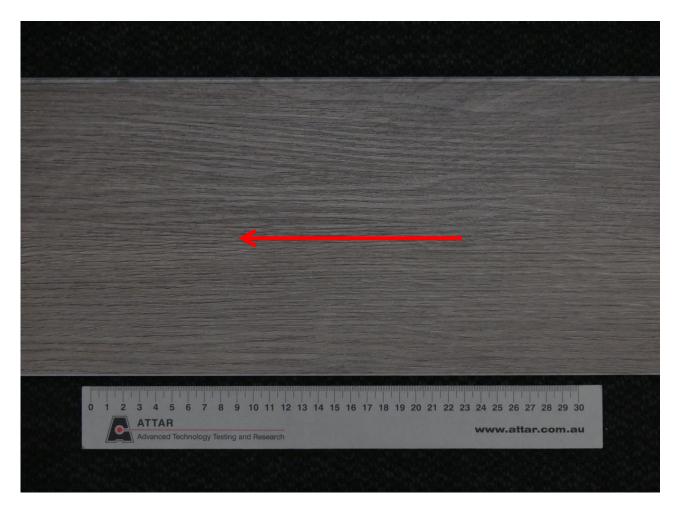


Figure 1: Kodiak Lite Arrow indicates direction of testing



#### CLASSIFICATION CRITERIA – AS 4586 - 2013 Oil Wet Inclining Platform Test – Appendix D

#### Compliance

# TABLE 5: CLASSIFICATION OF PEDESTRIANSURFACE MATERIALS ACCORDINGTO THE OIL-WET INCLINING PLATFORM TEST

Classification	Angle, degrees
No Classification	<6
R9	≥6 <10
R10	≥10 <19
R11	≥19 <27
R12	≥27 <35
R13	≥35